



# **DS1620**Digital Thermometer and Thermostat

#### **FEATURES**

- Requires no external components
- Measures temperatures from -55°C to +125°C in 0.5°C increments. Fahrenheit equivalent is -67°F to 257°F in 0.9°F increments
- Temperature is read as a 9-bit value
- Converts temperature to digital word in 200 ms, typical
- Thermostatic settings are user-definable and nonvolatile
- Data is read from/written via a 3-wire serial interface (CLK, DQ, RST)
- Applications include thermostatic controls, industrial systems, consumer products, thermometers, or any thermally sensitive system
- 8-pin DIP or SOIC package

#### PIN ASSIGNMENT





#### PIN DESCRIPTION

DQ – 3–Wire Input/Output

CLK/CONV – 3–Wire Clock Input and Standalone

Convert Input

RST - 3-Wire Reset Input

GND - Ground

T<sub>HIGH</sub> – High Temperature Trigger
T<sub>LOW</sub> – Low Temperature Trigger
T<sub>COM</sub> – High/Low Combination Trigger
V<sub>DD</sub> – Power Supply Voltage (+5V)

#### DESCRIPTION

The DS1620 Digital Thermometer and Thermostat provides 9—bit temperature readings which indicate the temperature of the device. With three thermal alarm outputs, the DS1620 can also act as a thermostat.  $T_{HIGH}$  is driven high if the DS1620's temperature is greater than or equal to a user–defined temperature is less than or equal to a user–defined temperature TL.  $T_{COM}$  is driven because  $T_{COM}$  is driven to a user–defined temperature TL.  $T_{COM}$  is driven

high when the temperature exceeds TH and stays high until the temperature falls below that of TL.

User–defined temperature settings are stored in non–volatile memory, so parts can be programmed prior to insertion in a system, as well as used in standalone applications without a CPU. Temperature settings and temperature readings are all communicated to/from the DS1620 over a simple 3–wire interface.

### **OPERATION-READING TEMPERATURE**

The DS1620 measures temperatures through the use of an onboard, proprietary temperature measurement technique. The temperature reading is provided in a 9-bit, two's complement format. Table 1 describes the exact relationship of output data to measured temperature. The data is transmitted serially through the 3-wire serial interface, LSB first. The DS1620 can measure temperature over the range of -55°C to +125°C in 0.5°C increments. For Fahrenheit usage, a lookup table or conversion factor must be used.

### **TEMPERATURE/DATA RELATIONSHIPS** Table 1

TEMP	DIGITAL OUTPUT (Binary)	DIGITAL OUTPUT (Hex)		
+125°C	0 11111010	00FA		
+25°C	0 00110010	0032h		
<sup>1</sup> / <sub>2</sub> °C	0 00000001	0001h		
0°C	0 00000000	0000h		
-1/ <sub>2</sub> °C	1 11111111	01FFh		
–25°C	1 11001110	01CEh		
–55°C	1 10010010	0192h		


Since data is transmitted over the 3–wire bus LSB first, temperature data can be written to/read from the DS1620 as either a 9–bit word (taking RST low after the 9th (MSB) bit), or as two transfers of 8–bit words, with the most significant 7 bits being ignored or set to zero, as illustrated in Table 1. After the MSB, the DS1620 will output 0's.

Note that temperature is represented in the DS1620 in terms of a <sup>1</sup>/<sub>2</sub>°C LSB, yielding the following 9-bit format:

							MSE	3								LSB
Х	х	Х	Х	Х	Х	Х	1		1	1	0	0	1	1	1	0

T = -25°C

# **DS1620 FUNCTIONAL BLOCK DIAGRAM** Figure 1

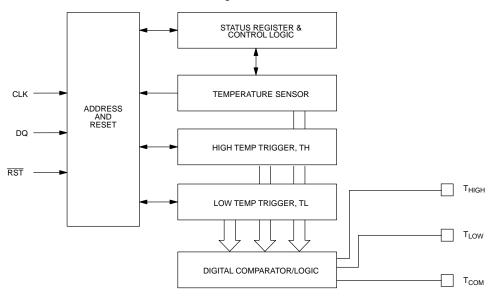

#### **DETAILED PIN DESCRIPTION** Table 2

PIN	SYMBOL	DESCRIPTION
1	DQ	Data Input/Output pin for 3-wire communication port.
2	CLK/CONV	Clock input pin for 3–wire communication port. When the DS1620 is used in a standalone application with no 3–wire port, this pin can be used as a convert pin. Temperature conversion will begin on the falling edge of CONV.
3	RST	Reset input pin for 3-wire communication port.
4	GND	Ground pin.
5	T <sub>COM</sub>	<b>High/Low Combination Trigger</b> . Goes high when temperature exceeds TH; will reset to low when temperature falls below TL.
6	T <sub>LOW</sub>	Low Temperature Trigger. Goes high when temperature falls below TL.
7	T <sub>HIGH</sub>	High Temperature Trigger. Goes high when temperature exceeds TH.
8	V <sub>DD</sub>	Supply Voltage. 5V input power pin.

#### OPERATION-THERMOSTAT CONTROLS


Three thermally triggered outputs,  $T_{HIGH}$ ,  $T_{LOW}$ , and  $T_{COM}$ , are provided to allow the DS1620 to be used as a thermostat, as shown in Figure 2. When the DS1620's temperature meets or exceeds the value stored in the high temperature trip register, the output  $T_{HIGH}$  becomes active (high) and remains active until the DS1620's measured temperature becomes less than the stored value in the high temperature register, TH. The  $T_{HIGH}$  output can be used to indicate that a high temperature tolerance boundary has been met or exceeded, or as part of a closed loop system can be used to activate a cooling system and to deactivate it when the system temperature returns to tolerance.

The  $T_{LOW}$  output functions similarly to the  $T_{HIGH}$  output. When the DS1620's measured temperature equals or

falls below the value stored in the low temperature register, the  $T_{LOW}$  output becomes active.  $T_{LOW}$  remains active until the DS1620's temperature becomes greater than the value stored in the low temperature register, TL. The  $T_{LOW}$  output can be used to indicate that a low temperature tolerance boundary has been met or exceeded, or as part of a closed loop system, can be used to activate a heating system and to deactivate it when the system temperature returns to tolerance.

The T<sub>COM</sub> output goes high when the measured temperature meets or exceeds TH, and will stay high until the temperature equals or falls below TL. In this way, any amount of hysteresis can be obtained.

#### **THERMOSTAT OUTPUT OPERATION** Figure 2

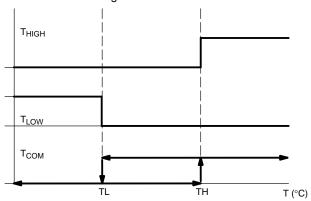

### **OPERATION AND CONTROL**

The DS1620 must have temperature settings resident in the TH and TL registers for thermostatic operation. A configuration/status register is also used to determine the method of operation that the DS1620 will use in a particular application, as well as indicating the status of the temperature conversion operation. The configuration register is defined as follows:

#### CONFIGURATION/STATUS REGISTER

DONE	THF	TLF	NVB	1	0	CPU	1SHOT
------	-----	-----	-----	---	---	-----	-------

where

DONE = Conversion Done bit. 1=conversion complete, 0=conversion in progress.

THF = Temperature High Flag. This bit will be set to 1 when the temperature is greater than or equal to the value of TH. It will remain 1 until reset by writing 0 into this location or by removing power from the device. This feature provides a method of determining if the DS1620 has ever been subjected to temperatures above TH while power has been applied.

TLF = Temperature Low Flag. This bit will be set to 1 when the temperature is less than or equal to the value of TL. It will remain 1 until reset by writing 0 into this location or by removing power from the device. This feature provides a method of determining if the DS1620 has ever been subjected to temperatures below TL while power has been applied.

NVB = Nonvolatile Memory Busy Flag. 1=write to an E<sup>2</sup> memory cell in progress. 0=nonvolatile memory is not busy. A write to E<sup>2</sup> may take up to 10 ms.

CPU = CPU use bit. If CPU=0, the CLK/CONV pin acts as a conversion start control, when RST is low. If CPU is 1, the DS1620 will be used with a CPU communicating to it over the 3–wire port, and the operation of the CLK/CONV pin is as a normal clock in concert with DQ and RST. This bit is stored in nonvolatile E² memory, capable of at least 50,000 writes.

1SHOT = One-Shot Mode. If 1SHOT is 1, the DS1620 will perform one temperature

conversion upon reception of the Start Convert T protocol. If 1SHOT is 0, the DS1620 will continuously perform temperature conversion. This bit is stored in nonvolatile E<sup>2</sup> memory, capable of at least 50.000 writes.

For typical thermostat operation, the DS1620 will operate in continuous mode. However, for applications where only one reading is needed at certain times, and to conserve power, the one–shot mode may be used. Note that the thermostat outputs (T<sub>HIGH</sub>, T<sub>LOW</sub>, T<sub>COM</sub>) will remain in the state they were in after the last valid temperature conversion cycle when operating in one–shot mode.

#### **OPERATION IN STANDALONE MODE**

In applications where the DS1620 is used as a simple thermostat, no CPU is required. Since the temperature limits are nonvolatile, the DS1620 can be programmed prior to insertion in the system. In order to facilitate operation without a CPU, the CLK/CONV pin (pin 2) can be used to initiate conversions. Note that the CPU bit must be set to 0 in the configuration register to use this mode of operation.

To use the CLK/CONV pin to initiate conversions, RST must be low and CLK/CONV must be high. If CLK/CONV is driven low and then brought high in less than 10 ms, one temperature conversion will be performed and then the DS1620 will return to an idle state. If CLK/CONV is driven low and remains low, continuous conversions will take place until CLK/CONV is brought high again. With the CPU bit set to 0, the CLK/CONV will override the 1–shot bit if it is equal to 1. This means that even if the part is set for one–shot mode, driving CLK/CONV low will initiate conversions.

#### 3-WIRE COMMUNICATIONS

The 3–wire bus is comprised of three signals. These are the  $\overline{RST}$  (reset) signal, the CLK (clock) signal, and the DQ (data) signal. All data transfers are initiated by driving the  $\overline{RST}$  input high. Driving the  $\overline{RST}$  input low terminates communication. (See Figures 3 and 4.) A clock cycle is a sequence of a falling edge followed by a rising edge. For data inputs, the data must be valid during the rising edge of a clock cycle. Data bits are output on the falling edge of the clock, and remain valid through the rising edge.

When reading data from the DS1620, the DQ pin goes to a high impedance state while the clock is high. Taking RST low will terminate any communication and cause the DQ pin to go to a high impedance state.

Data over the 3-wire interface is communicated LSB first. The command set for the 3-wire interface as shown in Table 3 is as follows; only these protocols should be written to the DS1620, as writing other protocols to the device may result in permanent damage to the part.

#### Read Temperature [AAh]

This command reads the contents of the register which contains the last temperature conversion result. The next nine clock cycles will output the contents of this register.

#### Write TH [01h]

This command writes to the TH (HIGH TEMPERATURE) register. After issuing this command, the next nine clock cycles clock in the 9-bit temperature limit which will set the threshold for operation of the  $T_{\mbox{\scriptsize HIGH}}$  output.

# Write TL [02h]

This command writes to the TL (LOW TEMPERATURE) register. After issuing this command, the next nine clock cycles clock in the 9-bit temperature limit which will set the threshold for operation of the  $T_{LOW}$  output.

#### Read TH [A1h]

This command reads the value of the TH (HIGH TEM-PERATURE) register. After issuing this command, the next nine clock cycles clock out the 9-bit temperature limit which sets the threshold for operation of the  $T_{\mbox{\scriptsize HIGH}}$  output.

# Read TL [A2h]

This command reads the value of the TL (LOW TEMPERATURE) register. After issuing this command, the next nine clock cycles clock out the 9–bit temperature limit which sets the threshold for operation of the  $T_{LOW}$  output.

# Start Convert T [EEh]

This command begins a temperature conversion. No further data is required. In one—shot mode, the temperature conversion will be performed and then the DS1620 will remain idle. In continuous mode, this command will initiate continuous conversions.

# Stop Convert T [22h]

This command stops temperature conversion. No further data is required. This command may be used to halt a DS1620 in continuous conversion mode. After issuing this command, the current temperature measurement will be completed, and then the DS1620 will remain idle until a Start Convert T is issued to resume continuous operation.

# Write Config [0Ch]

This command writes to the configuration register. After issuing this command, the next eight clock cycles clock in the value of the configuration register.

# Read Config [ACh]

This command reads the value in the configuration register. After issuing this command, the next eight clock cycles output the value of the configuration register.

### DS1620 COMMAND SET Table 3

INSTRUCTION	DESCRIPTION	PROTOCOL	3-WIRE BUS DATA AFTER ISSUING PROTOCOL	NOTES
	TEMPERATURE CONVERSION	N COMMANDS		
Read Temperature	Reads last converted temperature value from temperature register.	AAh	<read data=""></read>	
Start Convert T	Initiates temperature conversion.	EEh	idle	1
Stop Convert T	Halts temperature conversion.	22h	idle	1
	THERMOSTAT COMM	IANDS		
Write TH	Writes high temperature limit value into TH register.	01h	<write data=""></write>	2
Write TL	Writes low temperature limit value into TL register.	02h	<write data=""></write>	2
Read TH	Reads stored value of high temperature limit from TH register.	A1h	<read data=""></read>	2
Read TL	Reads stored value of low temperature limit from TL register.	A2h	<read data=""></read>	2
Write Config	Writes configuration data to configuration register.	0Ch	<write data=""></write>	2
Read Config	Reads configuration data from configuration register.	ACh	<read data=""></read>	2

#### NOTES:


- In continuous conversion mode, a Stop Convert T command will halt continuous conversion. To restart, the Start Convert T command must be issued. In one—shot mode, a Start Convert T command must be issued for every temperature reading desired.
- 2. Writing to the E<sup>2</sup> typically requires 10 ms at room temperature. After issuing a write command, no further writes should be requested for at least 10 ms.

# **FUNCTION EXAMPLE**


Example: CPU sets up DS1620 for continuous conversion and thermostatic function.

CPU MODE	DS1620 MODE (3-WIRE)	DATA (LSB FIRST)	COMMENTS
TX	RX	0Ch	CPU issues Write Config command.
TX	RX	02h	CPU sets DS1620 up for continuous conversion.
TX	RX	Toggle RST	CPU issues Reset to DS1620.
TX	RX	01h	CPU issues Write TH command.
TX	RX	0050h	CPU sends data for TH limit of +40°C.
TX	RX	Toggle RST	CPU issues Reset to DS1620.
TX	RX	02h	CPU issues Write TL command.
TX	RX	0014h	CPU sends data for TL limit of +10°C.
TX	RX	Toggle RST	CPU issues Reset to DS1620.
TX	RX	A1h	CPU issues Read TH command.
RX	TX	0050h	DS1620 sends back stored value of TH for CPU to verify.
TX	RX	Toggle RST	CPU issues Reset to DS1620.
TX	RX	A2h	CPU issues Read TL command.
RX	TX	0014h	DS1620 sends back stored value of TL for CPU to verify.
TX	RX	Toggle RST	CPU issues Reset to DS1620.
TX	RX	EEh	CPU issues Start Convert T command.
TX	RX	Toggle RST	CPU issues Reset to DS1620.

# **READ DATA TRANSFER** Figure 3

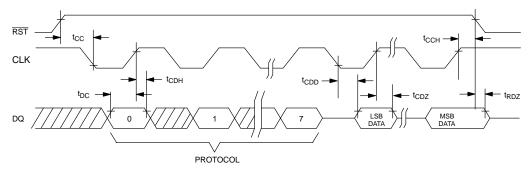

# WRITE DATA TRANSFER Figure 4

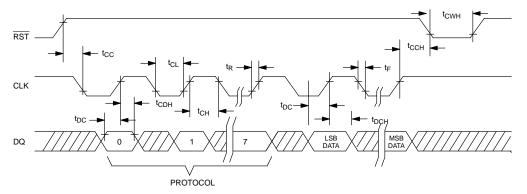

NOTE:  $t_{CL}$ ,  $t_{CH}$ ,  $t_{R}$ , and  $t_{F}$  apply to both read and write data transfer.

### **ABSOLUTE MAXIMUM RATINGS\***

Voltage on Any Pin Relative to Ground -0.5 V to +7.0 VOperating Temperature  $-55^{\circ}\text{C}$  to  $+125^{\circ}\text{C}$ Storage Temperature  $-55^{\circ}\text{C}$  to  $+125^{\circ}\text{C}$ Soldering Temperature  $260^{\circ}\text{C}$  for 10 seconds

# RECOMMENDED DC OPERATING CONDITIONS


PARAMETER	SYMBOL	MIN	TYP	MAX	UNITS	NOTES
Supply	$V_{DD}$	4.5	5.0	5.5	V	1
Logic 1	V <sub>IH</sub>	2.0		V <sub>CC</sub> +0.3	V	1
Logic 0	V <sub>IL</sub>	-0.3		+0.8	V	1

### DC ELECTRICAL CHARACTERISTICS

 $(-55^{\circ}\text{C to } +125^{\circ}\text{C}; V_{DD}=4.5\text{V to } 5.5\text{V})$ 

	( 00 0 10 10 0 0 0 0 0 0 0 0 0 0 0 0 0 0						
PARAMETER	SYMBOL	CONDITION	MIN	TYP	MAX	UNITS	NOTES
Thermometer Error	T <sub>ERR</sub>	0°C to +70°C			±0.5	°C	10, 11
		–55°C to +0°C and 70°C to 125°C		See Typical Curve			
Long-term Stability		105°C, 1000 hours		±0.1		°C	
Logic 0 Output	V <sub>OL</sub>				0.4	V	3
Logic 1 Output	V <sub>OH</sub>		2.4			V	2
Input Resistance	R <sub>I</sub>	DQ,RST to GND, CLK to V <sub>DD</sub>	1 1			MΩ MΩ	
Active Supply Current	I <sub>CC</sub>	0°C to +70°C			1	mA	4, 5
Standby Supply Current	I <sub>STBY</sub>	0°C to +70°C			1	μΑ	4, 5

### SINGLE CONVERT TIMING DIAGRAM (STAND-ALONE MODE)



<sup>\*</sup> This is a stress rating only and functional operation of the device at these or any other conditions above those indicated in the operation sections of this specification is not implied. Exposure to absolute maximum rating conditions for extended periods of time may affect reliability.

### **AC ELECTRICAL CHARACTERISTICS**

 $(-55^{\circ}\text{C to } +125^{\circ}\text{C}; V_{DD}=4.5\text{V to } 5.5\text{V})$ 

PARAMETER	SYMBOL	MIN	TYP	MAX	UNITS	NOTES
Temperature Conversion Time	T <sub>TC</sub>		200	500	ms	
Data to CLK Setup	t <sub>DC</sub>	35			ns	6
CLK to Data Hold	t <sub>CDH</sub>	40			ns	6
CLK to Data Delay	t <sub>CDD</sub>			100	ns	6, 7, 8
CLK Low Time	t <sub>CL</sub>	285			ns	6
CLK High Time	t <sub>CH</sub>	285			ns	6
CLK Frequency	f <sub>CLK</sub>	DC		1.75	MHz	6
CLK Rise and Fall	t <sub>R</sub> , t <sub>F</sub>			500	ns	
RST to CLK Setup	t <sub>CC</sub>	100			ns	6
CLK to RST Hold	t <sub>CCH</sub>	40			ns	6
RST Inactive Time	t <sub>CWH</sub>	125			ns	6, 9
CLK High to I/O High Z	t <sub>CDZ</sub>			50	ns	6
RST Low to I/O High Z	t <sub>RDZ</sub>			50	ns	6
Convert Pulse Width	t <sub>CNV</sub>	250 ns		500 ms		
NV Write Cycle Time	t <sub>WR</sub>		10	50	ms	

### **AC ELECTRICAL CHARACTERISTICS**

 $(-55^{\circ}\text{C to } +125^{\circ}\text{C}; V_{DD}=4.5\text{V to } 5.5\text{V})$ 

PARAMETER	SYMBOL	MIN	TYP	MAX	UNITS	NOTES
Input Capacitance	C <sub>I</sub>		5		pF	
I/O Capacitance	C <sub>I/O</sub>		10		pF	

## NOTES:

- 1. All voltages are referenced to ground.
- 2. Logic one voltages are specified at a source current of 1 mA.
- 3. Logic zero voltages are specified at a sink current of 4 mA.
- 4. I<sub>CC</sub> specified with DQ pin open.
- 5.  $I_{CC}$  specified with  $V_{CC}$  at 5.0V and  $\overline{RST}$ =GND.
- 6. Measured at  $V_{IH} = 2.0V$  or  $V_{IL} = 0.8V$ .
- 7. Measured at  $V_{OH} = 2.4V$  or  $V_{OL} = 0.4V$ .
- 8. Load capacitance = 50 pF.
- 9. t<sub>CWH</sub> must be 10 ms minimum following any write command that involves the E<sup>2</sup> memory.
- 10. See Figure 5 for specification limits outside 0°C to 70°C range.
- 11. Thermometer error reflects temperature accuracy as tested during calibration.

# **TYPICAL PERFORMANCE CURVE** Figure 5

# DS1620 DIGITAL THERMOMETER AND THERMOSTAT TEMPERATURE READING ERROR

